

Date: Tuesday, 08/01/2008 7:45:53 AM
User: Linda Lacelle

Process Sheet

Customer : CU-DAR001 Dart Helicopters Services Drawing Name : WEARSHOE
Job Number : 36653
Estimate Number : 12736
P.O. Number : N/A Part Number : D353515
This Issue : 08/01/2008 S.O. No. : N/A Drawing Number : D3535 REV B
Prsht Rev. : NC Project Number : N/A
First Issue : N/A Type : SMALL /MED FAB Drawing Revision : B
Previous Run : 34624 Material : N/A
Due Date : 18/01/2008 Qty: 20 Um: Each
Written By :
Checked & Approved By :
Comment : Est Rev:A New Issue 07-02-15 JLM
Est Rev:B As per Rev B 07-08-31 JLM Verified By:EC

Additional Product

Job Number:



Seq. #: Machine Or Operation: Description :

1.0 M304S20GA 304/316 .040 Sheet



27.859



Comment: Qty.: 1.0715 sf(s)/Unit Total : 21.4305 sf(s)

304/316 .040 Sheet

(M304S20GA)

Batch: 106748 HB 8-1-9

2.0 WATER JET FLOW WATER JET



Comment: FLOW WATER JET

1-Cut as per Dwg D3535

Dwg Rev: B

Prog Rev: B

HB 8-1-9

(26)

2-Deburr if necessary

HB 8-1-9

3.0 QC2 INSPECT PARTS AS THEY COME OFF MACHINE



HB 8-1-9



Comment: INSPECT PARTS AS THEY COME OFF MACHINE

4.0 QC8 SECOND CHECK



Comment: SECOND CHECK

08/01/09 (26)

5.0 BRAKE NC NC BRAKE



Comment: NC BRAKE

1-Form on Brake as per Dwg D3535 using Jigs DT8261 and DT8326

2-Form joggle as per Dwg D3535 using Jig DT8158

3-Identify as D3535-15

SP 08/01/09 (26)
08/01/09 (26)

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector	

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes ☒ No ☐ DQA: ☒ Date: 08/04/11
 QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 08/01/2008 7:45:53 AM
User: Linda Lacelle

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: WEARSHOE

Job Number: 36653

Part Number: D353515

Job Number:



Seq. #:

Machine Or Operation:

Description :

6.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

08/01/09 (426)

7.0

POWDER COATING

POWDER COATING



M105642



(26X)

Comment: POWDER COATING

Powder Coat Grey Sandtex (Ref: 4.3.5.6) as per QSI 005 4.3

Mrh 08/01/09

8.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

08-01-09

(X26)

9.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Identify and Stock

Location: FR-17

JD

08-01-09

(278)

10.0

QC21

FINAL INSPECTION/W/O RELEASE



Comment: FINAL INSPECTION/W/O RELEASE

2008/01/11

Job Completion



n 08.06.11

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector	

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			


NOTE: Date & initial all entries

DART

RELEASED

07.04.24

DESIGN	DRAWN BY	DART AEROSPACE USA, INC.	
CB	PH	PORT HADLOCK, WA	
CHECKED	APPROVED	DRAWING NO.	REV. B
<i>[Signature]</i>	<i>[Signature]</i>	D3535	SHEET 2 OF 7
DATE	TITLE	SCALE	
07.04.17	WEARSHOE	1:10	

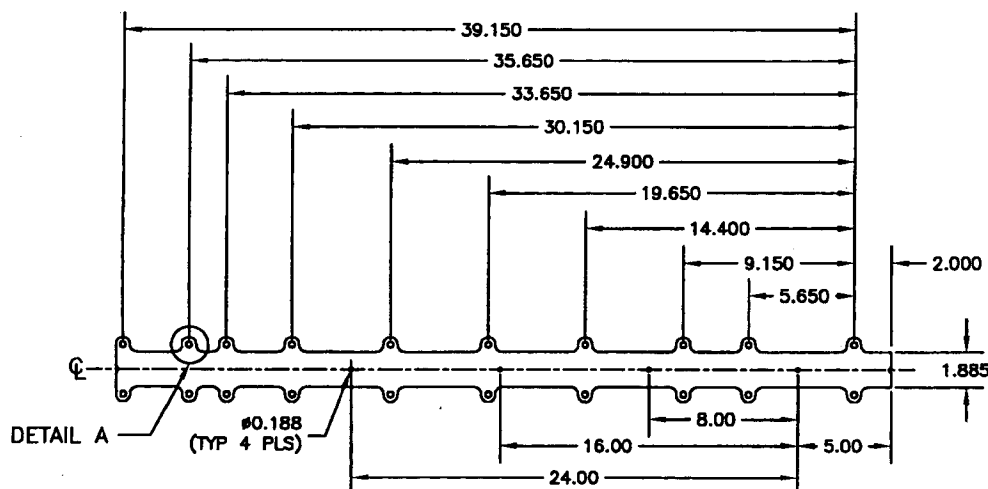


D3535-15F FLAT PATTERN

4.50 TO BEND
LINE (ON FLAT
PATTERN)

0.32
(REF)

D3535-15 BEND DETAIL

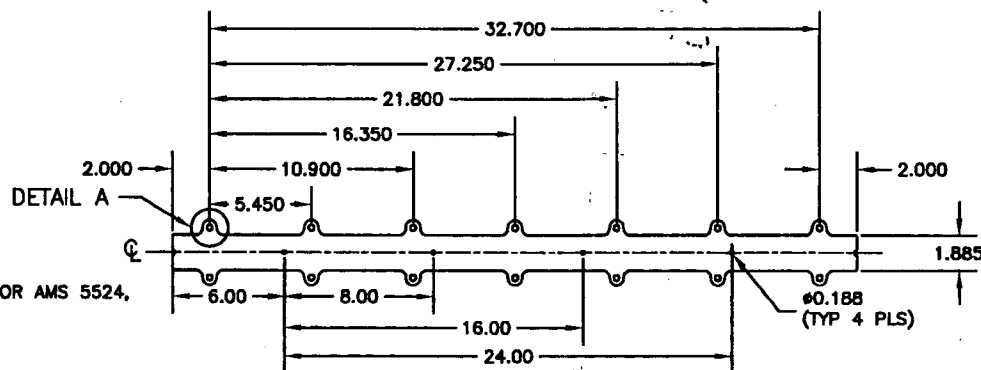

D3535-21F FLAT PATTERN

DETAIL B

D3535-21 BEND DETAIL

NOTES

- 1) MATERIAL: AISI 304/316 SS SHEET PER AMS 5513 OR AMS 5524, 20 GAUGE (0.038 THICK) (REF DART SPEC M304S20GA)
- 2) FINISH: POWDER COAT GREY SANDEX (4.3.5.6) PER QSI 005 4.3
- 3) PART IS SYMMETRICAL ABOUT ϕ
- 4) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED
- 5) ALL DIMENSIONS ARE IN INCHES
- 6) BREAK ALL SHARP EDGES TO 0.010 MAX
- 7) IDENTIFY WITH DART P/N USING WHITE FINE POINT PAINT MARKER
- 8) SEE PAGE 7 FOR DETAILS AND SECTION

W/24653

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector	

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____


NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries




DESIGN	C.B.	DRAWN BY	PH	DART AEROSPACE USA, INC.
CHECKED	<i>[Signature]</i>	APPROVED	<i>[Signature]</i>	PORT HADLOCK, WA
DATE	07.04.17	TITLE	WEARSHOE	REV. B
		DRAWING NO.	D3535	SHEET 7 OF 7
		SCALE	1:1	


RELEASED
07.04.24 *[Signature]*

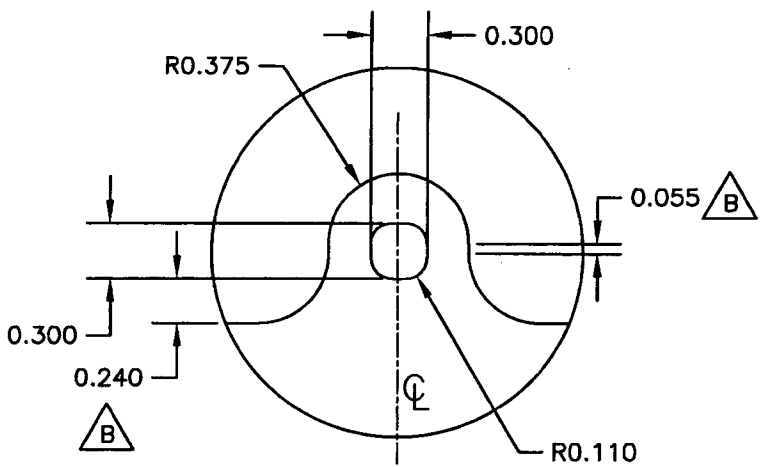

DETAIL A

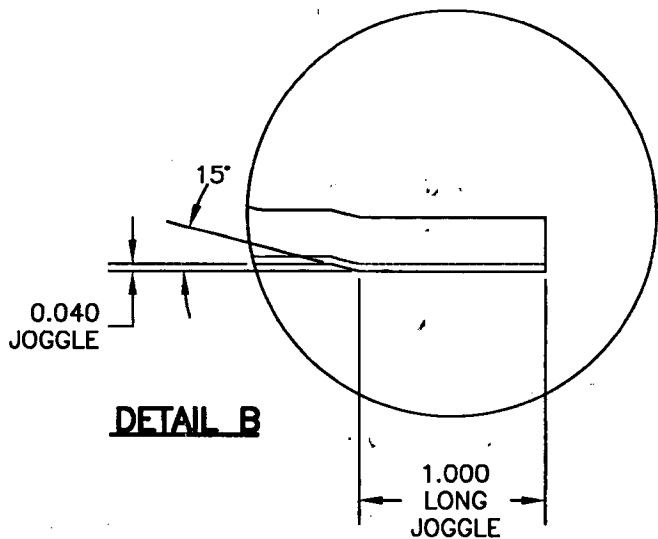

DETAIL B

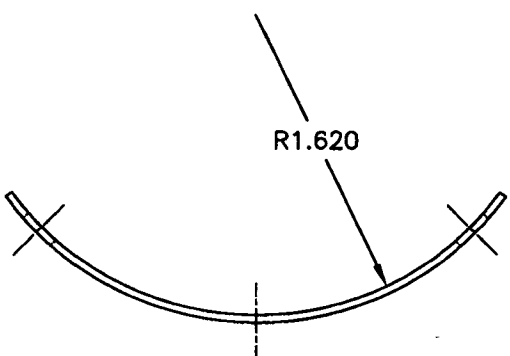

SECTION C-C

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector	

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

